

INSTALLATION INSTRUCTION

GAP KIT: Installation Instructions

ii001

Part Number: CG-100-55-12

Kit Contents

- 1 heatshrinkable wraparound sleeve
- 1 flexible channel
- 1 adhesive strip
- 1 cleaning tissue
- 1 aluminium cable foil
- 1 abrasive strip
- 1 installation instruction

Safety rules

Check environment for presence of gas and follow locally prescribed precautions

When working with open flame, use standard safety equipment such as gloves, safety glasses etc, as required by local practices


Recommended torch

Gas torch fitted with calor "C" nozzle




1. Prepare cable by creating a 100mm 'GAP' in the outer sheath.


Caution: Be careful not to cut in to the Sheath

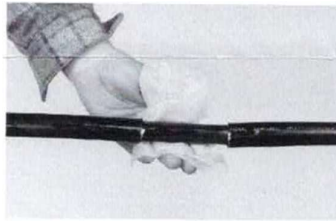

2. Using a cleaning tissue, clean the inner cable sheath and at least 100mm from each cable butt on the inner sheath.

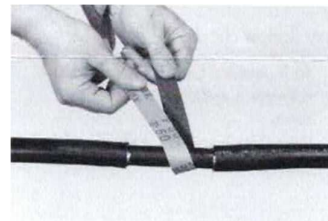

3. Circumferentially abrade the GAP and 100mm from each cleaned cable butt on the outer sheath.

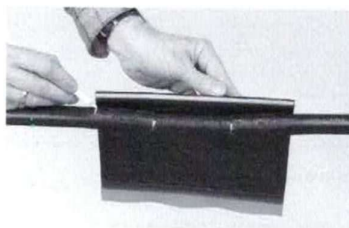

4. Centre the sleeve over the GAP and Mark the ends on the outer cable Sheath.



5. Apply aluminium cable foil, positioning the blue line at the mark. Smooth the foil with a blunt tool.



6. Flame brush the area between the cable aluminium foils for about 10 seconds using a soft flame.

© Hybrid Electrical Solutions Ltd 2025.

Web: www.hybridsolutionsgroup.co.uk

Tel: 0333 358 3650

Issue 001

INSTALLATION INSTRUCTION

© Hybrid Electrical Solutions Ltd 2025.

Web: www.hybridsolutionsgroup.co.uk

Tel: 0333 358 3650

Issue 001